
NSHV17 Inrush-withstand Protector



RoHS



Dimensions and construction:

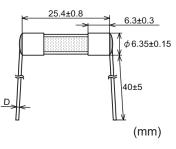

Tube:Lead-free glassEnd-cap:Nickel plated brassLead wire:Tin plated copperSolder:Pb90-Sn*Adhesive:Epoxy resinArc extinguishing material:ConfidentialMarking:SOC [rated current]DC500V NSHV17

Rated current	D
1 A–8 A:	$\phi 0.8$
Over 8 A–less than 15 A:	φ1.0
15 A–30 A:	φ1.2

* High melting temperature type solders, containing 85 wt% or more lead, that are exempted from the EU RoHS Directive for hazardous substances are used.

Electrical characteristics:

Maximum working voltage	Certification	Rated current (/ _N)	Maximum breaking current		Temperature rise	Current carrying capacity	Overload operation
DC 500 V		1 A–30 A	1,000 A	Resistive circuit	75 K or less at 0.5 / _N	Until temperature stabilization occurs at 1.0 / _N	Within 2 min at 2.0 / _N

Typical cold resistance:

Rated current	Cold resistance	Rated current	Cold resistance	Rated current	Cold resistance
1 A	228 mΩ	10 A	8.0 mΩ	20 A	3.4 mΩ
2 A	105 mΩ	12 A	7.1 mΩ	25 A	3.0 mΩ
6.3 A	14 mΩ	15 A	6.3 mΩ	30 A	2.0 mΩ


Note: These values are for reference only and are not intended to infer any guaranteed values.

Pre-arcing I-t characteristic:

These I-t curve plots are of the average values of the measurements obtained under the conditions specified by our company. These data are for reference only and are not intended to infer any guaranteed values. Characteristics of the protector may vary depending on the usage conditions. Always test the protector under the actual circuit conditions.


Control No.: 160616

SOC

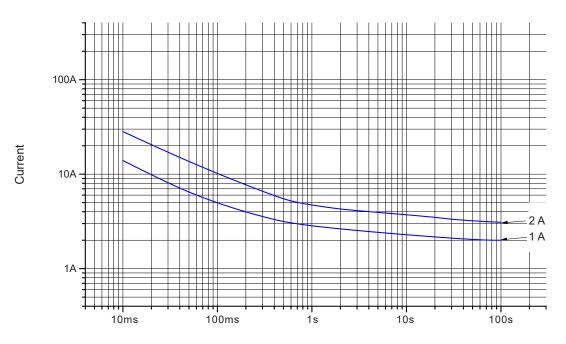

Pre-arcing time

Control No.: 180628

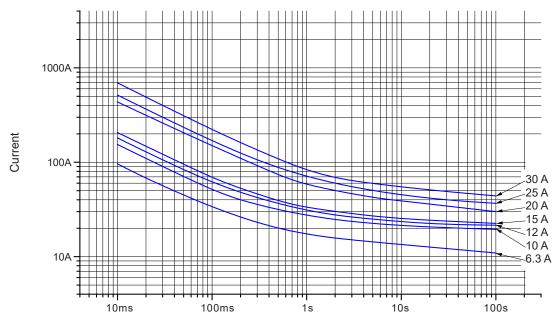


Pre-arcing time

Pre-arcing l²t-t characteristic:

These l²t-t curve plots are of the average values of the measurements obtained under the conditions specified by our company. These data are for reference only and are not intended to infer any guaranteed values. Characteristics of the protector may vary depending on the usage conditions. Always test the protector under the actual circuit conditions.


Control No.: 160616

SOC

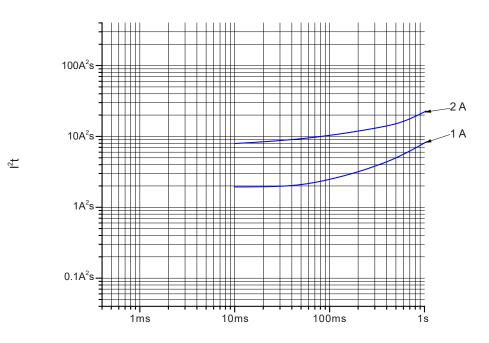

Time

Control No.: 180628

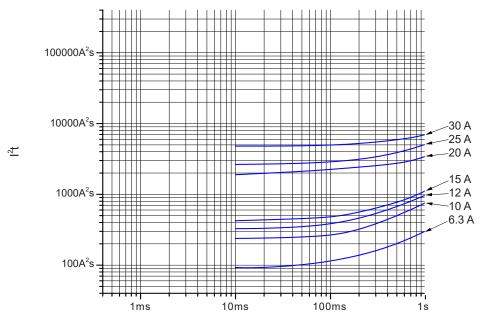


Time

Influence of ambient temperature-the re-rating of the rated current:

This chart is a plot of the measurements obtained at the ambient temperatures of -40 °C, 25 °C, and 85 °C under conditions specified by our company. The conditions of your actual application are not considered in this chart. These data are for reference purposes only and are not intended to infer any guaranteed values. Protector characteristics may vary depending on the usage conditions. Always test the protector under the actual circuit conditions.

Control No.: 180628

SOC

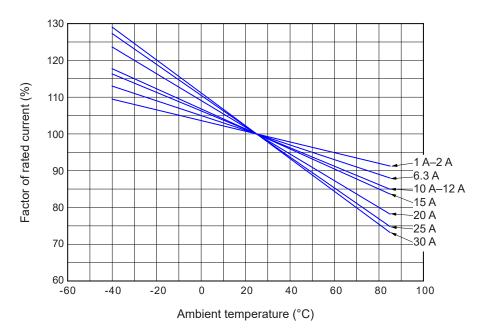

NSHV17 Inrush-withstand Protector

Mounting:

Wave soldering:


The soldering conditions stated below may be influenced by the material/shape and dimensions of the board, size of the copper foil, and/or heat capacity of the respective components on the board, besides such factors as temperature/duration of preheating, material of solder, temperature of the solder bath, and/or the duration of dipping.

- * Length of the lead between the protector body and the soldered surface of the board: L = 8 mm or more
- * Pre-heating: 80 °C-140 °C, 30 s-60 s
- * Temperature of molten solder: 260 °C or less
- * Duration: 7 s or less

Hand soldering with soldering iron:

Depending on the components to which the protector is attached (e.g., copper foil on the board) and/or heat capacity of the soldering iron tip, the soldering conditions may vary from those specified below.

- * Length of the lead between the protector body and the soldered surface of the board: L = 5 mm or more
- * Soldering iron tip temp.: 380 °C
- * Duration:



3 s or less

- * Care must be taken not to apply any stress such as bending, twisting, rotating, or tension to the lead wire and the end-cap during heating of the protector body by soldering and while it is kept at a high temperature of 40 °C or more.
- * Do not apply any stress to the lead wire while the protector body is being held, otherwise it may cause degradation of the end-cap portion. The part of the lead wire closest to the protector should be held firmly when the wire is formed.



Specifications described above are examples when facilities in our company are used. Please make sufficient evaluations under the actual conditions in your company because the conditions may vary depending on facilities, solder type, solder quantity, board size, and board material.

Usage conditions:

* Ambient temperature: -40 °C-+85 °C

* Ambient humidity: 85% RH or less

Note: Current carrying capacity of the protector may vary depending on the ambient temperature.

Storage conditions and storage period:

Products packaged as delivered can be stored for one year from the date indicated on the packing label under the following conditions:


* Ambient temperature:	−30 °C–+40 °C (no condensation)
* Ambient humidity:	85% RH or less
* Ambient atmosphere:	Not exposed to corrosive gas or sea breeze
	No visible dust
	Not exposed to direct sunlight
* Load:	No application of load that may cause deformation or degradation of the product.

Environmental information:

This product conforms to the EU RoHS Directive 2011/65/EU and 2015/863. The ten hazardous substances (lead, mercury, cadmium, hexavalent chromium, poly brominated biphenyls [PBB], poly brominated diphenyl ethers [PBDE], bis phthalate [DEHP], butyl benzyl phthalate [BBP], dibutyl phthalate [DBP] and diisobutyl phthalate [DIBP]) specified in the EU RoHS Directive are not used intentionally in this product. However, when lead is used in applications exempted from the requirements of the Directive, this will be indicated in the Dimensions and Construction section of the corresponding product specification.

Packaging:

- 1. 100 protectors are packed into a colorless transparent polyethylene bag.
- 2. An identification label is attached to each bag.
- 3. A bag of 100 protectors is packed into the cardboard case shown in the figure below. If the number of protectors is less than the fixed number, the protectors are still packed into the cardboard case in the same manner.
- 4. The following are indicated on the surface of the cardboard case:
 - * Your part number (by request)
 - * Quantity of protectors
 - * Packaged date
 - * Country of origin
 - * Manufacturer
 - * Production facilities

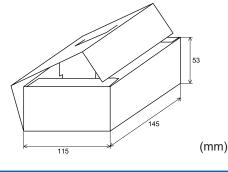

Lot number:

The lot number indicates the following:

Example: 17012371

170123: Date manufactured71: Process code



Ordering specifications:

SOC product name: NSHV17 [rated current]

Contact information:

SOC is a global ISO9001 and IATF16949 registered company headquartered in Japan with subsidiaries in Asia, Europe, and North America.

SOC Corporation Marketing Division:	3-16-17, Takanawa, Minato-ku, Tokyo 108-0074, Japan TEL +81-3-5420-1011 FAX +81-3-5420-6699 https://www.socfuse.com/contact/index.html
SOC America Inc.:	414 S Service Rd #519, Patchogue, NY 11772 USA TEL +1-631-472-6666 http://www.socamericainc.com info@socamericainc.com
SOC Asia Pte. Ltd.:	15 Jalan Kilang Barat, #07-02 Frontech Centre, Singapore 159357 TEL +65-6376-4115 http://www.socfuse.com/contact/index.html socjp@pacific.net.sg
SOC Europe B.V.:	Databankweg 1, 3821 AL Amersfoort, the Netherlands TEL +31-33-450-4000 http://www.soceurope.nl info@soceurope.nl

Safety Precautions for Fuse Selection and Use:



Read and follow these precautions before selecting and using fuses and protectors (hereafter "fuses"). Failure to properly select, install, and use fuses can result in not only property damage, but also serious injury or death.

Use fuses within their specification requirements. Exposing fuses to conditions that exceed or are outside specifications can lead to, for example, non-operation, nuisance operations, disconnection of the fuse-element, or explosions, and may cause injuries and/or property damage. Please note that breaking conditions for currents below the minimum breaking current and which exceed the rated breaking current are outside the range of the specification conditions. Please use this product after ensuring that the actual breaking conditions in the application are not included in this range.

Fuse performance can vary greatly due to the actual conditions fuses are operated under (ambient temperature, pulse currents, heat shock, mechanical stress, etc.). Please consider all conditions a fuse will be exposed to when making a selection. Depending on the conditions, non-operation, nuisance operations, disconnection of the fuse-element, explosions, or other accidents may occur, and these may cause injuries and/or property damage.

The breaking ability of a fuse will differ between AC and DC circuits. Use fuses with AC voltage ratings in AC circuits and fuses with DC voltage ratings in DC circuits. When using fuses with both AC and DC voltage ratings, attention should be given to any differences in breaking ability. A fuse's breaking ability indicates the fuse's ability in an AC or DC circuit. For example, if a fuse with an AC voltage rating is used in a DC circuit, the fuse's breaking ability will decrease, and injuries and/or property damage may occur.

Check if the circuit voltage is large enough for the fuse's operation. When the circuit voltage is too small, the decrease in current caused by an increase in the fuse's resistance may prevent the fuse from operating even for abnormal currents.

Do not use fuses in environments with high humidity or corrosive or flammable gases. Doing so may result in nuisance operations, disconnection of the fuse-element, or an explosion.

Do not use ultrasonic waves to clean fuses. Ultrasonic cleaning may cause disconnection of the fuse-element.

Do not form a fuse's leads when the fuse is at a temperature of 40 °C or greater. Doing so may result in disconnection of the fuse-element because of the applied stress.

Do not apply coating or potting to any fuses except sealed fuses, such as the MCFA, or their equivalents, including the MCF3. Doing so may cause disconnection of the fuse-element or a change in the fuse's characteristics. Please be aware that even sealed fuses or the equivalent are not hermetically sealed, and therefore make sure to confirm no coating or potting material has penetrated the interior or any other location of the fuse before use. As coating or potting a fuse will changes its characteristics, make sure to confirm that a coated or potted fuse still satisfies all requirements under actual usage conditions.

Avoid applying excessive force when inserting a fuse into a fuse holder. Doing so may result in the fuse cracking or in contact failure, and this may significantly reduce its ability to work properly or may shorten its life.

When a fuse is used in equipment that directly affects human life or that requires a high degree of reliability, more closely examine and evaluate the fuse in actual circuit conditions than is necessary for use in other general electronic equipment.

Do not touch fuses when they are carrying a current. Doing so may result in electrocution or serious burns.

Fuses obtained as samples should only be used for evaluation. Do not reuse fuses, but instead properly dispose of them.

For final fuse selection, make sure to install the fuse in the actual application in order to confirm the selected fuse satisfies all requirements.